MONITOR NOZZLES

Model LMLV
3 position monitor nozzle
LMLV-080IF / LMLV-080BF



PRODUCT DESCRIPTION

The monitor nozzles models LMLV-080IF & LMLV-080BF can be used with either water or any type of foam solutions. They are simple and reliable design. They provide excellent nozzle range and an easy operation.

This solidly constructed industrial nozzle offers superior stream quality and reach. Nozzle discharge pattern is controlled by adjusting the stream pattern sleeve on the nozzle body Suitable for use with water or foam solution.

It is manufactured in bronze or stainless steel all with SS internal.

With the ability to deliver optimum performance with any foam concentrate.

Maximum reach on stream is achieved at approximately 30 degrees elevation. The jet stream can be affected by wind direction.


TECHNICAL DATA

Models	LMLV-080IF LMLV-080BF
Water inlet connection	Threaded female 3” BSP
Nozzle flow range	1500 to 3030 lpm (400 to 800 gpm)
Maximum service pressure	12 bar (175 psi)
Jet and fog pattern	With Spinning teeth 120 degree angle
Material of construction	LMLV-080IF: Stainless Steel LMLV-080BF: Bronze
Weight (Approx.)	LMLV-080IF: 9,4 Kg LMLV-080BF: 9 Kg


***NOTE:** FM approved with bronze material.

C/Alfoz de Bricia nº4 | P.I. Villalonquéjar | 09001 Burgos (Spain) | Tlfno: +34 947 28 11 08

DIMENSIONS

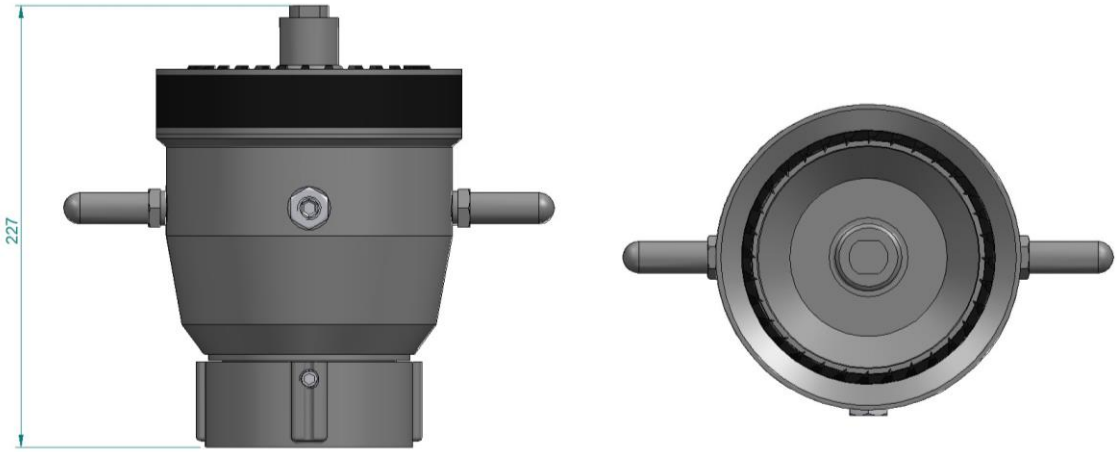

FLOW TRAJECTORY

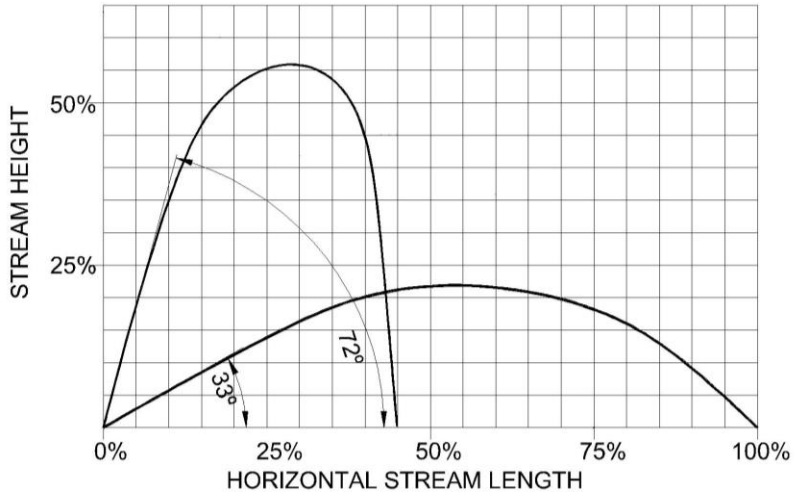

PERFORMANCE DATA

MODEL	**SET FLOW RATE** lpm (gpm)	**NOZZLE PRESSURE** kg/cm.sq. (psi)	**ACTUAL FLOW RATE** lpm (gpm)	**STRAIGHT STREAM FOAM RANGE** meters (feet)
LMLV-080IF LMLV-080BF	1500 (400)	6 (85) 7,4 (105) 8,8 (125)	1344 (355) 1502 (397) 1645 (434)	55 (180) 59 (193) 61 (200)
	1900 (500)	6 (85) 7,4 (105) 8,8 (125)	1702 (450) 1902 (502) 2082 (550)	58 (190) 62 (203) 64 (209)
	2270 (600)	6 (85) 7,4 (105) 8,8 (125)	2032 (537) 2272 (600) 2487 (657)	59 (193) 63 (206) 65 (213)
	2650 (700)	6 (85) 7,4 (105) 8,8 (125)	2372 (626) 2652 (700) 2905 (767)	62 (203) 64 (209) 65 (213)
	3030 (800)	6 (85) 7,4 (105) 8,8 (125)	2712 (716) 3032 (801) 3321 (877)	64 (209) 66 (216) 67 (219)

Some ranges based on exterpolation of existing data and observations. Data are based at 30 deg. Nozzle elevation. The reach is reduced from 10% when premixed water foam solution.

C/Alfoz de Bricia nº4 | P.I. Villalonquéjar | 09001 Burgos (Spain) | Tlfno: +34 947 28 11 08

INSTALLATION, TESTING AND MAINTENANCE

First of all, after unpacking the nozzle check that it does not have any apparent damage. Do not install the nozzle if show something irregular.

The nozzle must be installed, inspected and tested by a qualified and trained person. It must be inspected regularly for possible damage or dirt around the moving parts. If any abnormal conditions are observed such as poor discharge, excessive wear, water leak, corrosion effect, damage etc., then nozzle must be taken out of service and repaired by a qualified technician or replaced.

The debris trapped in the nozzle may affect the nozzle performance. To remove trapped debris, the water flow must be stopped and thereafter carefully unscrew and remove the nozzle deflector. Clean the nozzle and reassemble. While re-assembling the nozzle or as a normal preventive maintenance, water proof lubricant must be used on seal and moving parts for smooth operation. The nozzle must be operated periodically under full flow straight stream and for fog pattern.

Under normal condition water must be flown through the nozzle periodically and dirt around exterior moving parts must be cleaned, allowing nozzle to operate properly.

The nozzle must be inspected prior to and after each use. Greasing the moving parts and 'O' ring is required periodically. Over a time the seals may need to be replaced.

The owner is responsible for maintenance of the nozzle in proper operating condition.

After use with foam, nozzle should be flushed with fresh water.

CAUTION

A trained personnel for fire fighting, with appropriate guidance & training must use the product to reduce the risk or injury. The nozzle must be fixed to the monitor carefully. The mismatched or damaged threads may cause leakage or uncouple the nozzle during operation.

Application of water or foam on an electric appliance can cause serious injury by electrocution, as water is a conductor of electricity.

The water supply to the nozzle must be gradual. Sudden surge of water supply must be avoided. The monitor mounting must be supported properly to support the nozzle reaction force.

ORDERING INFORMATION

INLET SIZE	MATERIAL	
	BRONZE	STAINLESS STEEL
3" DN80	LMLV-080-BF	LMLV-080-IF

Specify:

Model	
Quantity	
Material	

C/Alfoz de Bricia nº4 | P.I. Villalonquéjar | 09001 Burgos (Spain) | Tlfno: +34 947 28 11 08

AG FIRE SPRINKLER

AG Fire Sprinkler offers a wide selection of components. Then a list of products is presented by AG Fire Sprinkler, we can offer all these components, made with precision to protect people, anywhere, anytime.

- Sprinklers
  - Standard Coverage
  - Extended Coverage
  - Storage
  - Dry
  - Accessories
- System Valves
  - Wet
  - Dry
  - Preaction Equipment
  - Accessories
- Spray System Open Nozzles
  - High Velocity Nozzles
  - Medium Velocity Nozzles
  - Window Nozzles
  - Hydroshield Nozzles
  - Mushroom Type Nozzles
- Foam equipment
  - Tanks
  - Proportioners
  - Foam Discharge Equipment
  - Foam Concentrates
- Deluge equipment for Water Spray and Foam
  - Clapper Deluge Valves
  - Diaphragm Deluge Valves
- Monitors
  - Manual Monitors
  - Remote Monitors
  - Monitor Nozzles
  - Towers and Trolleys
- Valves
  - Butterfly Valves
  - Gate Valves
  - Check Valves
  - Pressure Control Valves
  - Test and Drain
  - Hose, Hydrant and Fire Connection Valves
  - Fire Department Connections

The equipment presented in this bulletin is to be installed in accordance with the latest published Standard of the National Fire Protection Association, Factory Mutual Research Corporation, or other similar organizations and also with the provisions of governmental codes or ordinances whenever applicable.
This documentation is not contractual. AG Fire Sprinkler reserves the right to any kind of change without notice.

C/Alfoz de Bricia nº4 | P.I. Villalonquéjar | 09001 Burgos (Spain) | Tlfno: +34 947 28 11 08